

SHARP PARTS GUIDE

CODE : 00ZXEA202UPGE

MODEL XE-A202

PRINTER : M-T53II

(U,A version)

CONTENTS


- ① Exteriors.
- ② Keyboard unit
- ③ Packing material & Accessories
- ④ Drawer box unit(SJ-415 type)[for U]
- ⑤ Drawer box unit(SJ-423 type)[for A]
- ⑥ Main + Print PWB unit
- ⑦ Display + Key PWB unit
- ⑧ Pou up PWB unit
- ⑨ Articles for consumption
- ⑩ Special service tools
- index

Parts marked with "△" are important for maintaining the safety of the set. be sure to replace these parts with specified ones for maintaining the safety and performance of the set.

1 Exteriors

[illegible]

1 Exteriors

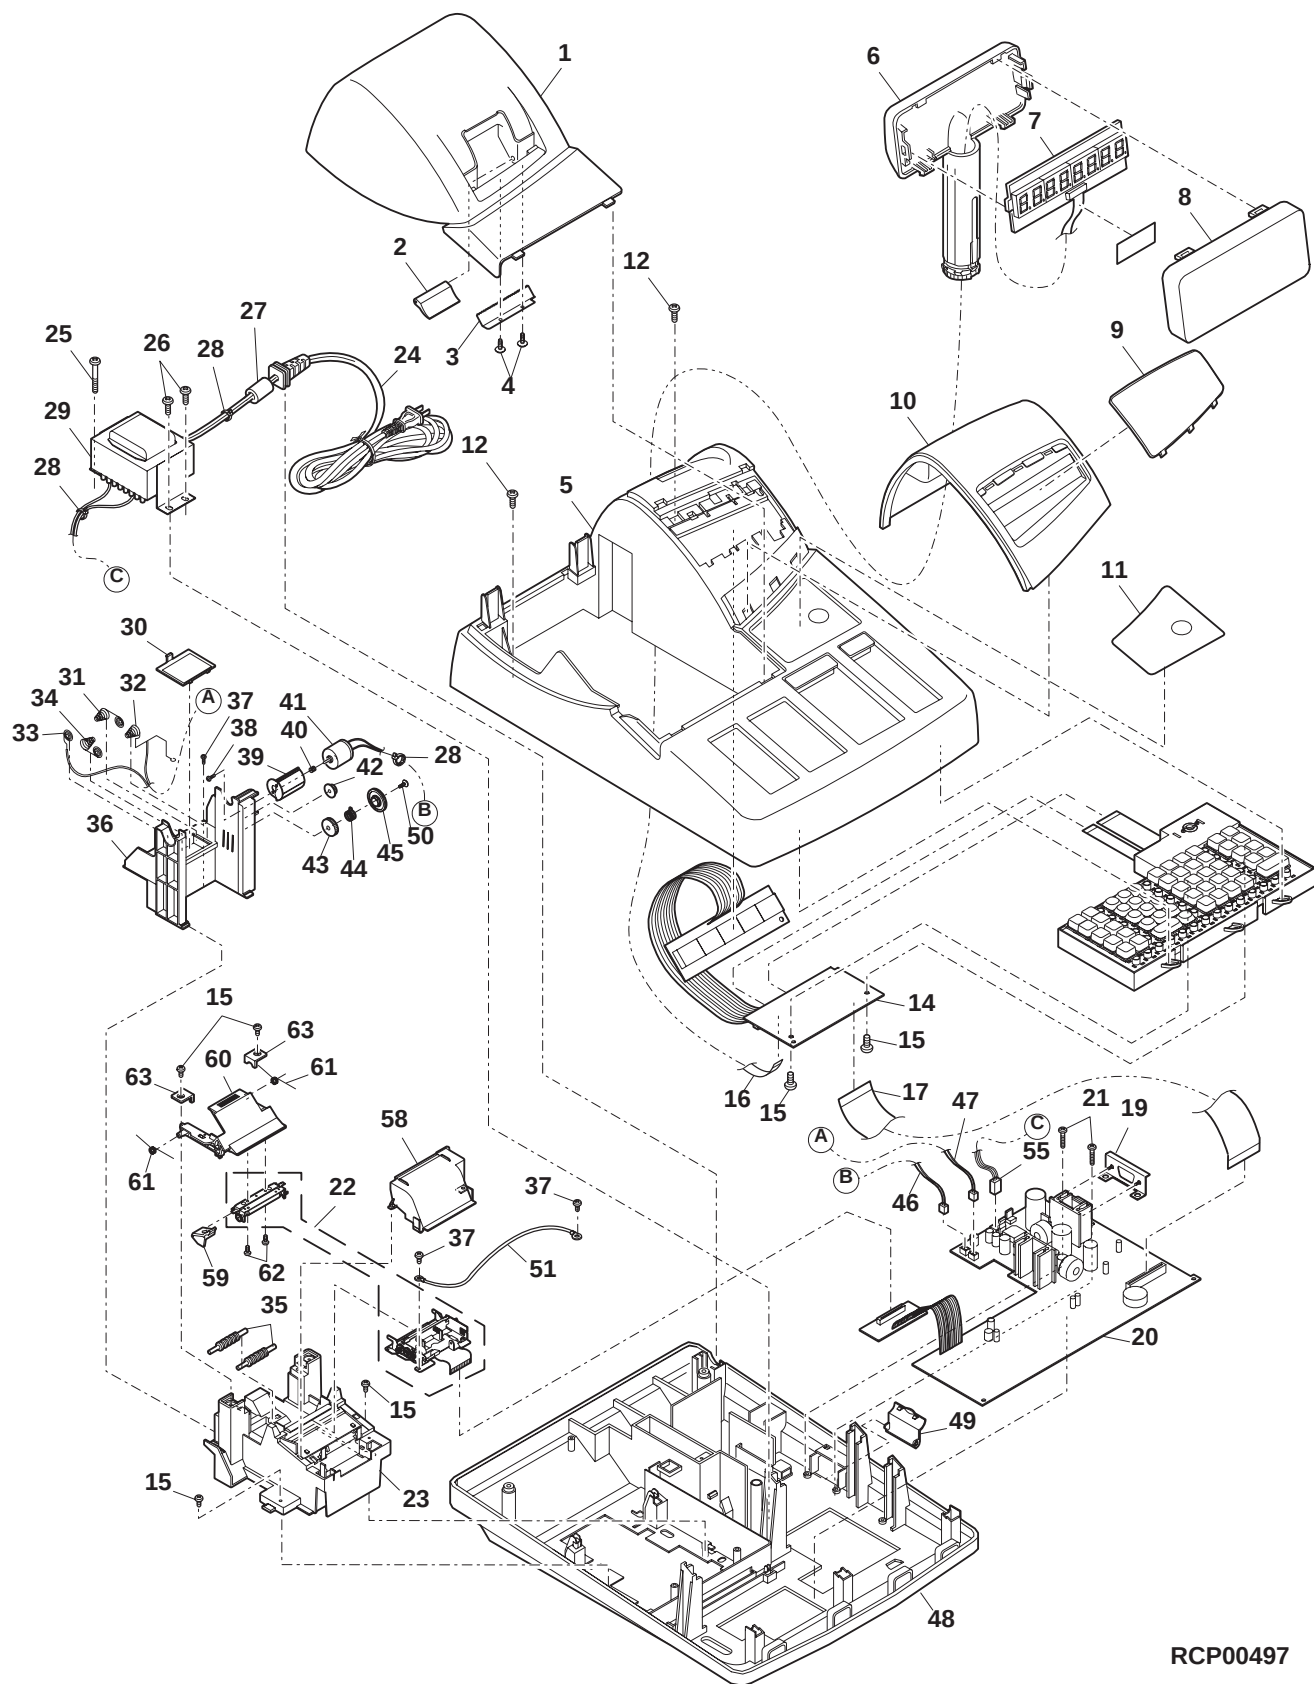

RCP00497


2 Keyboard unit

NO.	PARTS CODE	PRICE RANK	NEW MARK	PART RANK	DESCRIPTION
1	J K N B Z 2 4 2 4 B H Z Z	AG		C	Key cap(1x1)
2	J K N B Z 2 4 2 5 B H Z Z	AN		C	Key cap(1x2)
3	L H L D Z 6 8 3 7 B H Z Z	AE		C	Holder L(WHITE)
4	L H L D Z 6 8 3 6 B H Z Z	AE		C	Holder R(YELLOW)
5	L F R M - 2 3 6 6 B H Z Z	BC		D	Key frame
6	C K N B Z 2 3 9 9 B H 0 7	BA	N	C	Key top unit
7	P G U M M 2 4 4 7 B H Z Z	BA		C	Key rubber
8	C S H E P 2 9 4 3 B H Z Z	BD		B	Key sheet assy'
9	L P L T M 2 3 6 8 B H Z Z	AY		C	Keyboard plate
10	X J P S D 3 0 P 0 6 0 0 0	AA		C	Screw(3x6)
11	X J P S D 3 0 P 0 6 0 0 0	AA		C	Screw(3x6)
12	L A N G Q 7 6 0 4 R C Z Z	AD		C	M/sw earth angle
13	L K G i W 0 0 0 1 B H Z A	AS		B	Mode sw(body)
14	Q C N C M 7 1 3 6 B H Z Z	AB		C	Connector(MLX 5229-13APB)
501	K i - Ö K 2 0 1 9 B H 0 3	BL	N	E	Keyboard unit


3 Packing material & Accesories

[illegible]

2 Keyboard unit

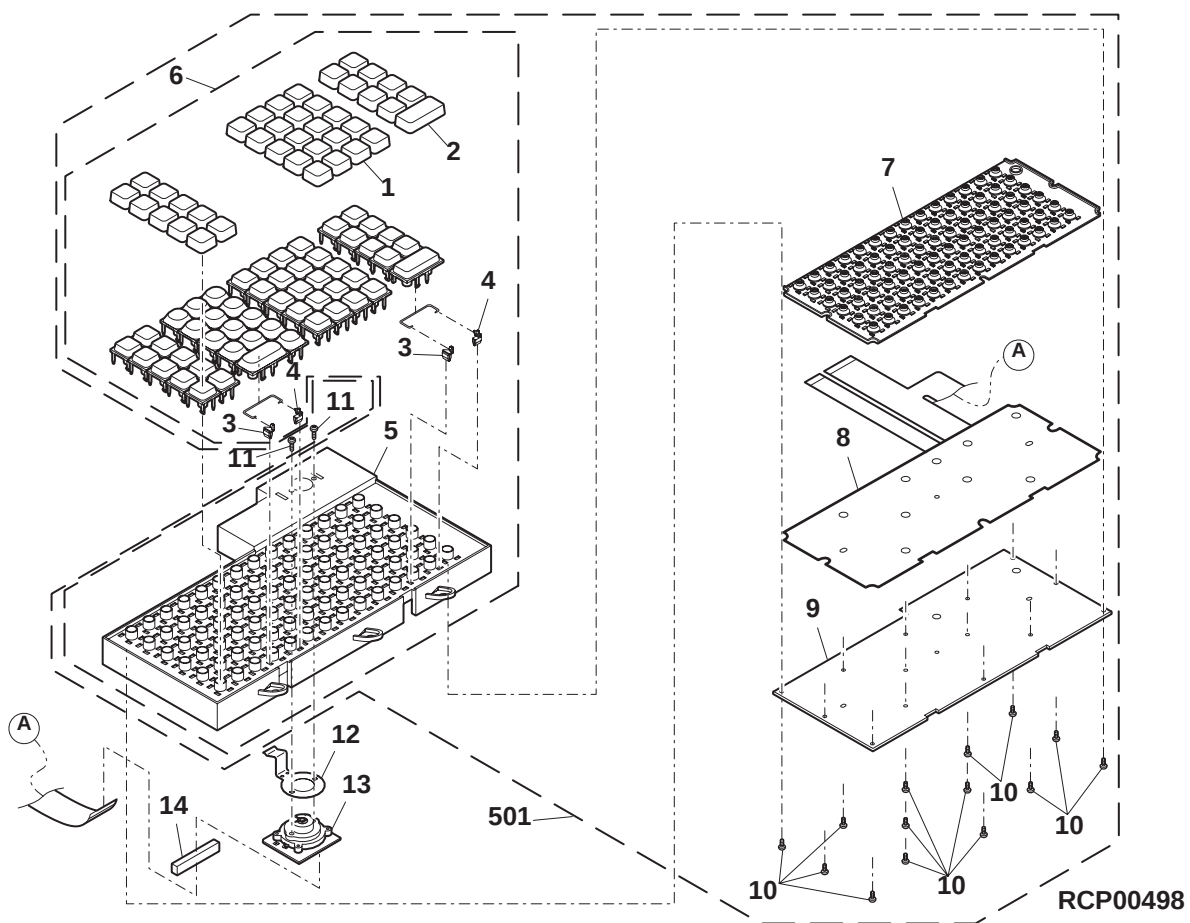


3 Packing material & Accesories

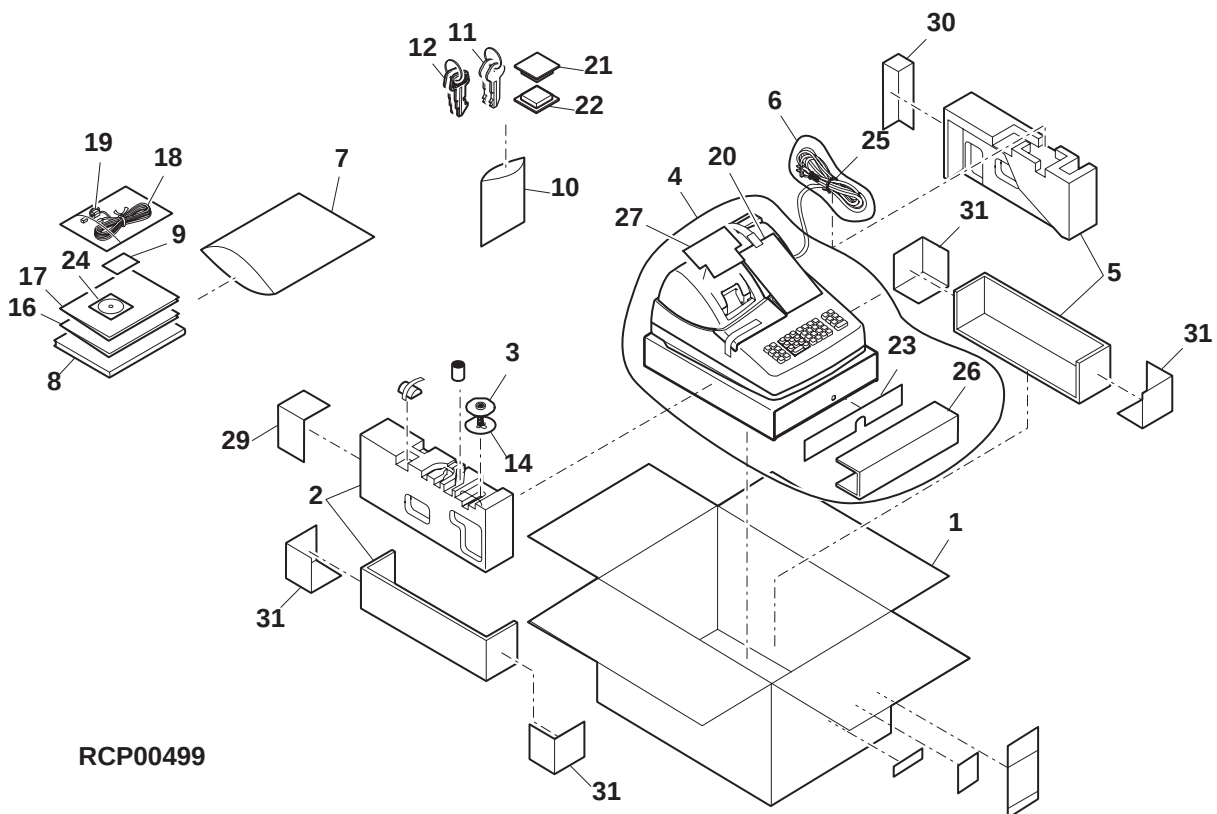

4 Drawer box unit (SJ-415 Type)[for U]

[illegible]

4 Drawer box unit (SJ-415 Type)[for U]

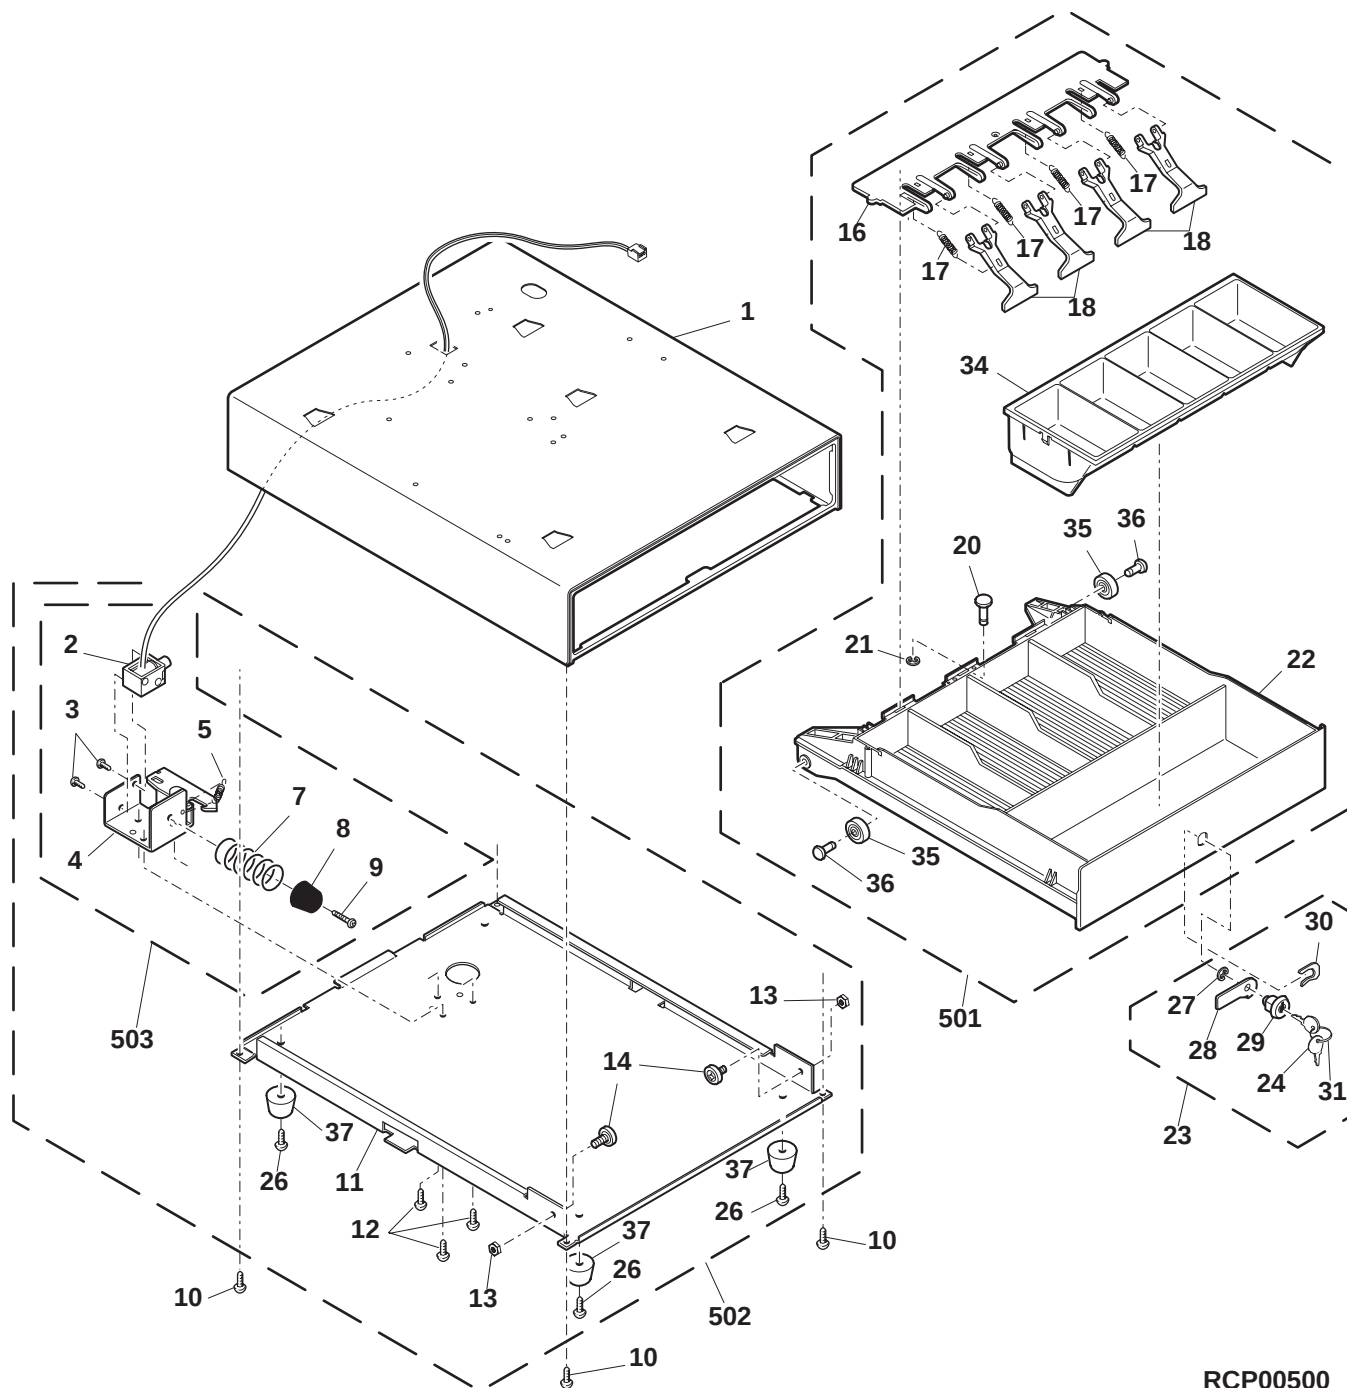


RCP00500

5 Drawer box unit(SJ423 type)[for A]

[illegible]

5 Drawer box unit(SJ423 type)[for A]

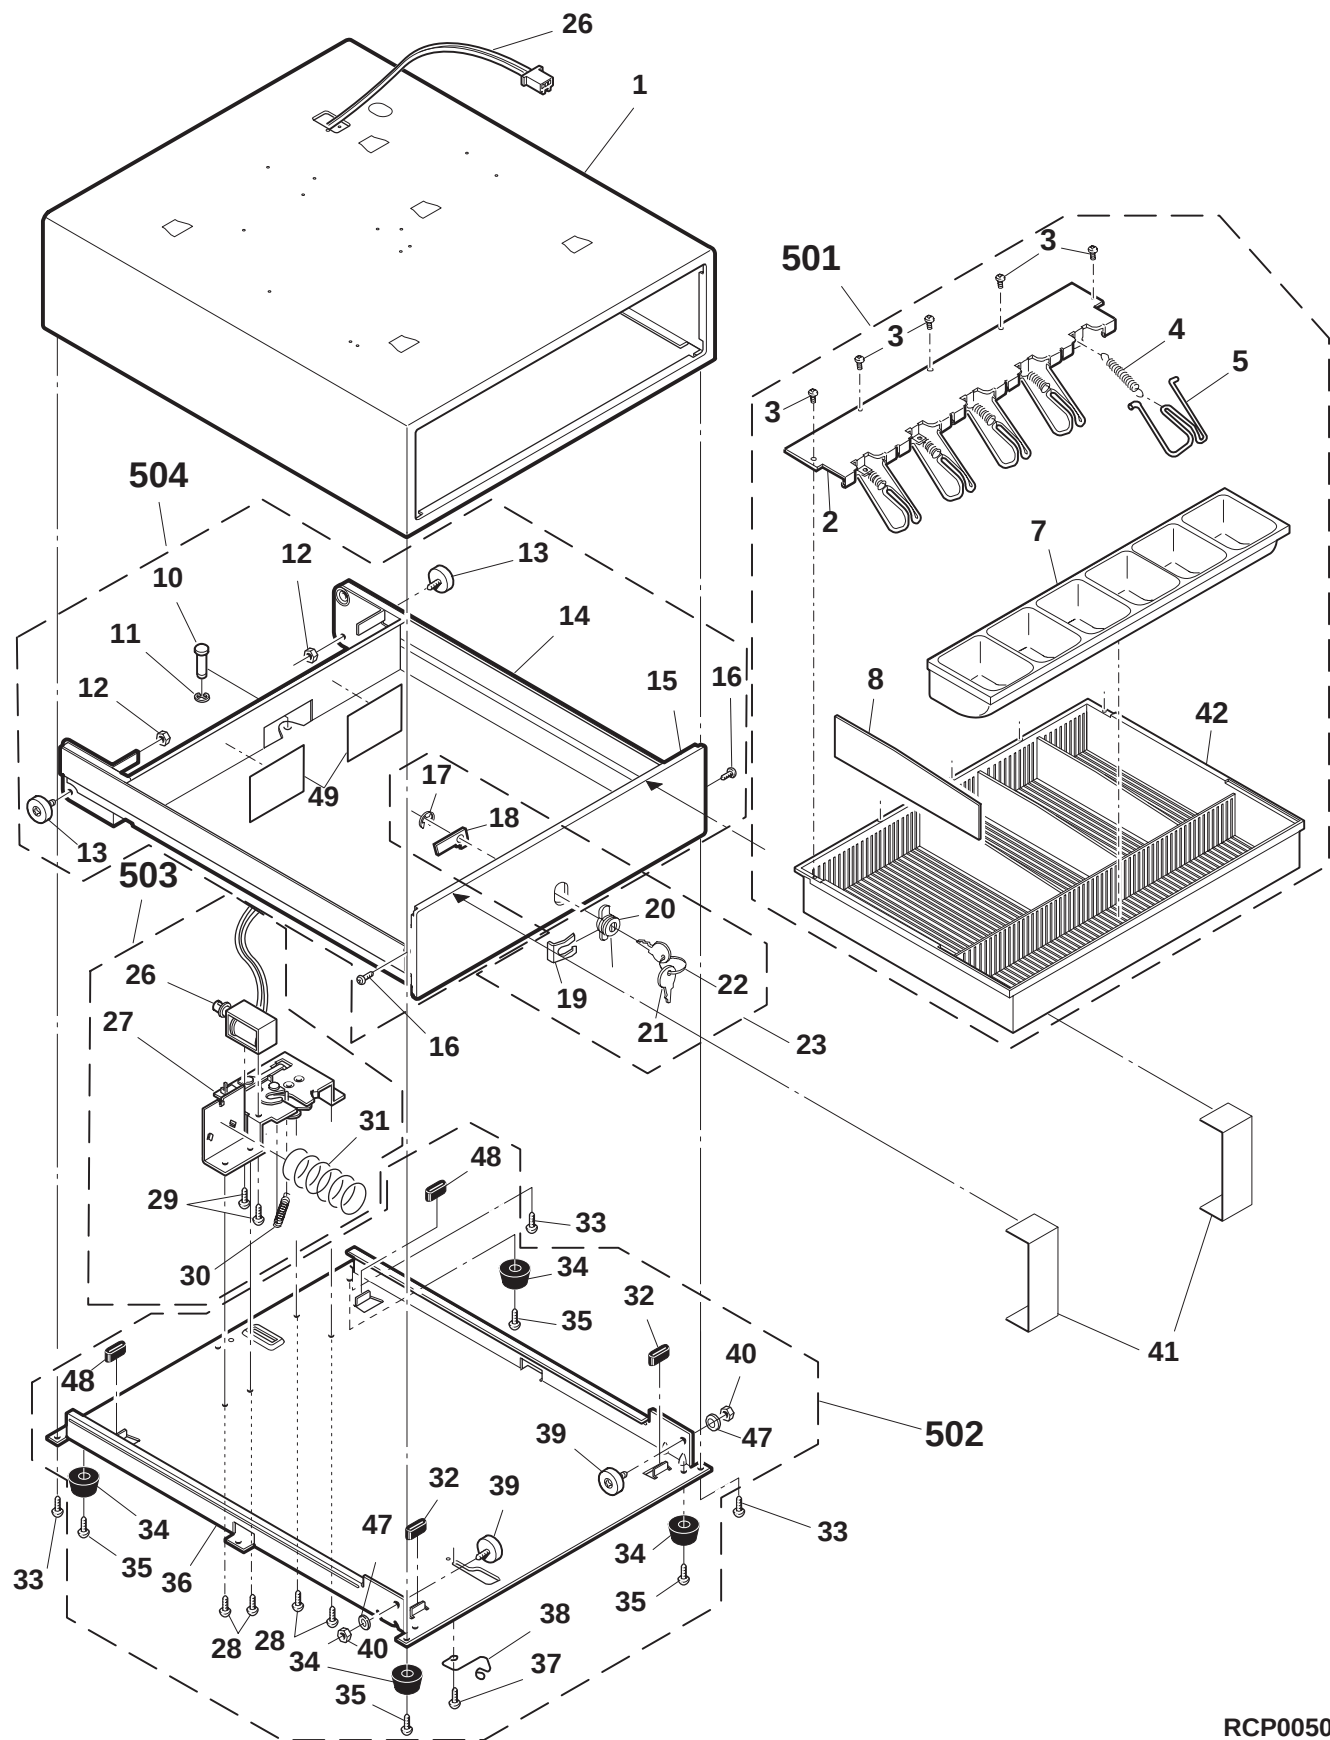

RCP00501

6 Main + Print PWB unit

NO.	PARTS CODE	PRICE RANK	NEW MARK	PART RANK	DESCRIPTION
1	LANGT2849RCZZ	AC		C	RS-232C angle [CN9]
2	LX-BZ2189BHZZ	AA		C	Screw [for HEAT SINK]
3	PRDAF2374BHZA	AM		C	Heat sink [IC2,3]
4	PRDAF2374BHZZ	AM		C	Heat sink [Q1]
5	QCNCM3020RCZZ	AD		C	Short socket(JM-2BK-61) [SP1]
6	QCNCM3021RCZZ			C	PS connector(B2P-VH) [CN1]
7	QCNCM3022RCZZ			C	Motor connector(B2B-EH-A) [CN5]
8	QCNCM3023RCZZ	AC		C	BAT Connector(B2B-XH-A-E)(BLUE) [CN2]
9	QCNCM7057BHZZ	AB		C	Connector(5045-3)(3pin) [CN6]
10	QCNCW3016RCZZ	AE		C	K/B Connector(34FE-BT-VK-N) [CN3]
11	QCNW-3156BHZA	AP		C	PR I/F cable 2 [4A-4C]
12	QCNW-3156BHZZ	AN		C	PR I/F cable [4B-4D]
13	QCNW-7813BHZZ	AF		C	GND wire(MAIN-MAIN) [G5,6,7]
14	QFS-B0322QCZZ	AC		A	Fuse(UL125V 3.15A) [F1]
15	QFSD2109AFZZ	AC		C	Fuse holder(HD2109AF) [F1]
16	QFS-K2007BHZZ	AF		A	Fuse(LT-5,T500mA/250V) [F6]
17	QFS-K2315BHZZ	AF		A	Fuse(LT5 T1.0AL/250V) [F3]
18	QPIN-0003GCZZ	AC		C	Pin(T3B-SQ) [SP1]
19	QSOCN2328BHZZ	AH		C	D-SUB Connector(DBR50-09K1300) [CN9]
20	RALMB5006SCZZ	AD		B	Buzzer(EFB-RD22C01) [BZ]
21	RCILC2422RCZZ			C	Coil(220μH) [L3]
22	RCILC2427RCZZ			C	Coil(180μH) [L2]
23	RCILC2428RCZZ			C	Coil(63μH) [L1]
24	RC-KZ1054CCN2	AB		C	Capacitor(RPE132-906)(50WV 0.1μF) [C59,66,72,76,77,80,89,96]
25	RCORF7002BHZZ	AE		C	Chip core(EFCB322513TS) [FB8-15]
26	RCRSP6676RCZZ	AG		B	X-TAL(32.768KHz) [X1]
27	RCRSZ2400RCZZ	AH		B	X-TAL(12MHz) [X2]
28	VCCCTV1HH101J	AA		C	Capacitor(50WV 100PF) [C37,57]
29	VCCCTV1HH180J	AA		C	Capacitor(50WV 18pF) [C43]
30	VCCCTV1HH270J	AA		C	Capacitor(50WV 27pF) [C44]
31	VCCCTV1HH300J	AA		C	Capacitor(50WV 30pF) [C56]
32	VCCCTV1HH331J	AA		C	Capacitor(50WV 330PF) [C73]
33	VCEAGU1CW106M	AA		C	Capacitor(16WV 10μF)(VCEAGA1CW106M) [C98,C58]
34	VCEAGA1CW337M	AB		C	Capacitor(16WV 330μF) [C8]
35	VCEAGU1HW106M	AB		C	Capacitor(50WV 10μF)(VCEAGA1HW106M) [C78,88]
36	VCEAGA1HW227M	AC		C	Capacitor(50WV 220μF) [C4,11]
37	VCEAGA1HW475M	AA		C	Capacitor(50WV 4.7μF) [C107]
38	VCEAGU1HW476M	AB		C	Capacitor(50WV 47μF)(VCEAGA1HW476M) [C75]
39	VCEAGD1CW108M	AE		C	Capacitor(16WV 1000μF) [C5]
40	VCEAGD1CW478M	AP		C	Capacitor(16WV 4700μF) [C3]
41	VCEAZU1HW338M		N	C	Capacitor(3300μF/50V) [C2]
42	VCEAZU1VW108M	AE		C	Capacitor(35WV 1000μF) [C13]
43	VCKYPU1HB101K	AA		C	Capacitor(50WV 100PF)(VCKYPA1HB101K) [C16-19,C28-35]
44	VCKYPU1HB102K	AA		C	Capacitor(50WV 1000pF)(VCKYPA1HB102K) [C90-94]
45	VCKYPU1HB151K	AA		C	Capacitor(50WV 150pF)(VCKYPA1HB151K) [C20-27,C45-54,(55),70]
46	VCKYTV1HB222K	AA		C	Capacitor(50WV 2200pF) [C38]
47	VCKYTV1HF104Z	AA		C	Capacitor(50WV 0.10μF) [C10,15,39,65,71,74,84-87,97]
48	VCQYKU1HM223K	AB		C	Capacitor(50WV 0.022μF)(VCQYKA1HM223K) [C12]
49	VCQYNA1HM333K	AA		C	Capacitor(50WV 0.033μF) [C1]
50	VCQYNU1HM104K	AB		C	Capacitor(50WV 0.10μF) [C9]
51	VHD1N4002/-1			B	Diode(1N4002) [D7,8]
	VHD1N4002/-1			B	Diode(1N4002) [CN7]
52	VHDCP301/-1	AL		B	Diode(CP301) [D1]
53	VHDDSS133/-1	AA		B	Diode(1SS133) [D3,4,5,12,13,16]
54	VHDFMB-G24H/1	AH		B	Diode(FMG-G24H) [D2]
55	VHDRB060L/-1	AK		B	Diode(RB060L40) [D6,10]
56	VHDRB721Q/-1	AE		B	Diode(RE721Q) [D9]
57	VHEMTZJ5R1B-1	AB		B	Zener diode(MTZJ5R1B) [ZD4]
58	VHEPTZ6.2A/-1	AH		B	Zener diode(PTZ6.2A) [ZD2]
59	VHEPTZ9.1B+-1	AG		B	Zener diode(PTZ9.1B) [ZD1]
60	VHEUDZ4.3B/-1	AE		B	Zener diode(UDZ4.3B) [D11]
61	VHi2574NADJ-1	AW		B	IC(2574NADJ) [IC1]
62	VHi30624FGA03		N	B	CPU UNIT(30624FGA03) [IC5]
63	VHi621024M7-1	AZ		B	S-RAM 1M(LP621024DM-70)(SOP) [IC9]
64	VHi80928CNM-1			B	IC(S-80928ANMP) [IC15]
65	VHiBA10393F-1	AC		B	IC(BA10393F) [IC4]
66	VHiHiN211CA-1	AN		B	IC(HiN211CA) [IC14]
67	VHiLB1838M+-1	AT		B	IC(LB1838M) [IC13]
68	VHiPQ1CG2032F	AL		B	IC(PQ1CG2032FZ) [IC2,3]
69	VHiSN74HC138N	AL		B	IC(74HC138) [IC16,17]
70	VHiSN74HC374D	AL		B	IC(SN74HC374D) [IC8]
71	VRD-HT2EY101J	AA		C	Resistor(1/4W 100Ω ±5%) [R46-53,108-112,246]
	VRD-HT2EY103J	AA		C	Resistor(1/4W 10KΩ ±5%) [R21,22,25,26,27,28,29,30,31,32,37,38,39,40,41,42,43,44]
72	VRD-HT2EY103J	AA		C	Resistor(1/4W 10KΩ ±5%) [R45,72,75,76,77,85,87,88,89,90,97,99,242,247]
	VRD-HT2EY103J	AA		C	Resistor(1/4W 10KΩ ±5%) [R23,24,33,34,35,36,63,64,65,66,67,68,69,70,71,73,74,79]
73	VRD-HT2EY202J	AA		C	Resistor(1/4W 2KΩ ±5%) [R98]
74	VRD-HT2EY221J	AA		C	Resistor(1/4W 220Ω ±5%) [R8]
75	VRD-HT2EY223J	AA		C	Resistor(1/4W 22KΩ ±5%) [R1]

6 Main + Print PWB unit

NO.	PARTS CODE	PRICE RANK	NEW MARK	PART RANK	DESCRIPTION
76	VRD-HT2EY272J	AA		C	Resistor(1/4W 2.7KΩ ±5%) [R15]
77	VRD-HT2EY330J	AA		C	Resistor(1/4W 33Ω ±5%) [R249]
78	VRD-HT2EY332J	AA		C	Resistor(1/4W 3.3KΩ ±5%) [R56]
79	VRD-HT2EY335J	AA		C	Resistor(1/5W 3.3MΩ ±5%) [R9]
80	VRD-HT2EY472J	AA		C	Resistor(1/4W 4.7KΩ ±5%) [R100]
81	VRD-HT2EY473J	AA		C	Resistor(1/4W 47KΩ ±5%) [R78,81,82,83,84]
82	VRD-HT2EY912G	AA		C	Resistor(1/4W 9.1KΩ ±2%) [R16]
83	VRG-ST2EJ100J	AC		B	Fuse resistor(1/4W 10Ω ±5%) [R2]
84	VRS-CY1JD000J	AA		C	Resistor(1/16W 0Ω ±5%) [R17,61,114,244]
85	VRS-CY1JD102J	AA		C	Resistor(1/16W 1.0KΩ ±5%) [R101,102]
86	VRS-CY1JD103F	AB		C	Resistor(1/16W 10KΩ ±1%) [R93,94]
87	VRS-CY1JD103J	AA		C	Resistor(1/16W 10KΩ ±5%) [R11,13,243]
88	VRS-CY1JD104J	AA		C	Resistor(1/16W 100KΩ ±5%) [R58]
89	VRS-CY1JD183J	AA		C	Resistor(1/16W 18KΩ ±5%) [R3]
90	VRS-CY1JD222J	AA		C	Resistor(1/16W 2.2KΩ ±5%) [R113]
91	VRS-CY1JD223J	AA		C	Resistor(1/16W 22KΩ ±5%) [R10]
92	VRS-CY1JD272J	AA		C	Resistor(1/16W 2.7KΩ ±5%) [R20]
93	VRS-CY1JD332F	AA		C	Resistor(1/16W 3.3KΩ ±1%) [R5]
94	VRS-CY1JD333J	AA		C	Resistor(1/16W 330Ω ±5%) [R60]
95	VRS-CY1JD471J	AA		C	Resistor(1/16W 470Ω ±5%) [R86]
96	VRS-CY1JD473J	AA		C	Resistor(1/16W 47KΩ ±5%) [R55,80]
97	VRS-CY1JD563J	AA		C	Resistor(1/16W 56KΩ ±5%) [R19]
98	VRS-CY1JD821J	AA		C	Resistor(1/16W 820Ω ±5%) [R57]
99	VRSCY1JR1782F			C	Resistor(1/10W 17.8K ±1% 1608) [R4]
100	VRS-CY2AY243F	AA		C	Resistor(1/10W 24KΩ ±1%) [R241]
101	VRS-CY2AY272F	AA		C	Resistor(1/10W 2.7KΩ ±1%) [R6]
102	VRS-CY2AY303F	AA		C	Resistor(1/10W 30KΩ ±1%) [R96]
103	VRS-CY2AY392J	AA		C	Resistor(1/10W 3.9KΩ ±5%) [R18]
104	VRS-CY2AY473F	AA		C	Resistor(1/10W 47KΩ ±1%) [R59]
105	VRS-CY2AY510J	AA		C	Resistor(1/10W 51Ω ±5%) [R12]
106	VRS-CY2AY561J	AA		C	Resistor(1/10W 560Ω ±5%) [R14]
107	VRS-CY2AY911F	AA		C	Resistor(1/10W 910Ω ±1%) [R7]
108	VRS-TQ2BJ000J			C	Resistor(1/8W 0Ω ±5% 3216) [R248]
109	VS2SD2212+-1	AG		B	Transistor(2SD2212) [Q9,13]
110	VS2SK2731/-1	AD		B	Transistor(2SK2731) [Q7]
111	VSKRA106S/-1	AF		B	Transistor(KRA106S) [Q3]
112	VSKRC106S/-1	AD		B	Transistor(KRC106S) [Q2,4]
113	VSKRC111S/-1	AD		B	Transistor(KRC111S) [Q8,14]
114	VSKTD998/-1	AS		B	Transistor(2SD998) [Q1]
115	XBPSD30P06000	AA		C	Screw(3×6) [IC2,3,Q1]
201	QCNCW3018RCZZ	AF	N	C	PR connector(27FMN-BTK-A) [CN31]
	(Unit)				
901	CPWBF2920RCE2	BU	N	E	Main+Prt PWB unit

7 Display + Key PWB unit

NO.	PARTS CODE	PRICE RANK	NEW MARK	PART RANK	DESCRIPTION
1	QCNCW2909BHZZ	AK		C	K/B connector(52045-1245) [CN21]
2	QCNCW2910BHZZ	AK		C	K/B connector(52044-2245) [CN22]
3	QCNCW3016RCZZ	AE		C	K/B connector(34FE-BT-VK-N) [CN23]
4	QCNCW3017RCZZ	AD		C	Key-Pop up connector(15FMN-BTK-A) [CN24]
5	QCNCW-3268RCZZ	AE		C	Dis.-Key cable(9P)
6	RC-KZ1054CCN2	AB		C	Capacitor(RPE132-906)(50WV 0.1μF) [C105]
7	VCEAGU1CW107M	AB		C	Capacitor(16WV 100μF)(VCEAGA1CW107M) [C104]
8	VCKYPU1HB101K	AA		C	Capacitor(50WV 100PF)(VCKYPA1HB101K) [C106]
9	VHDDSS133/-1	AA		B	Diode(1SS133) [D21-31]
10	VH1KID65083AP	AM		B	IC(KID65083AP) [IC23]
11	VRD-HT2EY121J	AA		C	Resistor(1/4W 120Ω ±5%) [R218-227]
12	VRD-HT2EY473J	AA		C	Resistor(1/4W 47KΩ ±5%) [R201-207,228]
13	VRS-CY1JD123J	AA		C	Resistor(1/16W 12KΩ ±5%) [R208-217]
14	VSKRA101M/-1	AD		B	Transistor(KRA101M) [Q29-38]
15	VSKTA1663/-1	AE		B	Transistor(KTA1663) [Q23-28,39]
16	VSKTA1664/-1	AD		B	Transistor(KTA1664) [Q20-22]
101	VHPLA56S2S20C	AQ		B	LED(LA56S2-S2) [LED1-5]
102	VRD-HT2EY300J	AA		C	Resistor(1/4W 30Ω ±5%) [R233-240]
	(Unit)				
901	CPWBF2920RCE1		N	E	Display + Key PWB unit

8 Pou up PWB unit

NO.	PARTS CODE	PRICE RANK	NEW MARK	PART RANK	DESCRIPTION
1	QCNCW7202BH1E	AK		C	Connector(52807-1510) [CN1]
2	VHPLA56S2S20C	AQ		B	LED(LA56S2-S2) [LED6,LED7,LED8]
3	VHPLA56S1S20C	AN		B	LED(LA56S1-S2) [LED9]
4	VRD-HT2EY270J	AA		C	Resistor(1/4W 27Ω ±5%) [R1,R2,R3,R4,R5,R6,R7,R8]
	(Unit)				
901	CPWBF2928RCE1	AX		E	Pop up PWB unit

9 Articles for compsumption

NO.	PARTS CODE	PRICE RANK	NEW MARK	PART RANK	DESCRIPTION
1	T P A P R 2 3 7 7 R C 0 5	AY		S	Roll paper(5roll/pack)

10 Special service tools

[illegible]

Index

PARTS CODE	NO.	PRICE RANK	NEW MARK	PART RANK	
【C】					
CBOXD7158RCZZ	4-901	BM		E	
CCABM2569RCZZ	4-1	BA		D	
CCABM7250BH01	5-1	BF		E	
CCAS-6692RC05	4-501	BD		E	
CCASP6690RC02	5-501		N	E	
CDRW-2320RC01	5-504		N	E	
CDRW-2320RCZZ	5-14		N	E	
CFRM-6686RC02	4-4	AK		D	
CFRM-6701RC01	5-27		N	E	
CKNBZ2399BH07	2-6	BA	N	C	
CLOK-6674RC06	4-503	AW		E	
CPLTM2402RC01	5-502		N	E	
CPLTM6688RC09	4-502	BB		E	
CPLU-1003BHZZ	4-2	AZ		B	
CPWBF2920RCE1	1-14		N	E	
“	7-901		N	E	
CPWBF2920RCE2	1-20	BU	N	E	
“	6-901	BU	N	E	
CPWBF2928RCE1	1-7	AX		E	
“	8-901	AX		E	
CSHEP2943BHZZ	2-8	BD		B	
【D】					
DUNT-1306RCZA	4-23	AX		E	
“	5-23	AX	N	E	
DUNTM5818RC01	5-503		N	E	
【G】					
GBOXD7159RCZZ	5-901		N	E	
GCABA2572BHZA	1-48	BC		D	
GCABB2571BHZZ	1-5	BA		D	
GCABB7861RCSA	1-6	AG		D	
GCAS-6690RCZZ	5-42		N	D	
GCAS-6691RCZZ	5-7		N	D	
GCAS-6692RCSA	4-22	BA		D	
GCAS-6693RCSA	4-34	AU		D	
GCASP2337BHZZ	1-36	AR		D	
GCASP2343RCZZ	1-23	AT		D	
GCASP2344RCZZ	1-60	AR		D	
GCASP2345RCZZ	1-63	AE		D	
GCOVA2588RCZZ	5-15		N	D	
GCOVB2527BH01	1-1	AX		D	
GCOVB2529BHZZ	1-10	AS		D	
GCOVB2530BHZZ	1-49	AE		D	
GCOVB2536BHZZ	1-39	AG		D	
GCOVB2595RCZZ	1-58	AN		D	
GFTAB6775RCSE	1-30	AD		D	
【H】					
HDECP2004RCSN	1-11	AG	N	D	
HDECP2004RCSS	1-11		N	D	
【J】					
JKNBZ2424BHZZ	2-1	AG		C	
JKNBZ2425BHZZ	2-2	AN		C	
【K】					
Ki-OB2379RCZZ	1-22	BF		E	
Ki-OK2019BH03	2-501	BL	N	E	
【L】					
LANGQ7604RCZZ	2-12	AD		C	
LANGT2849RCZZ	1-19	AC		C	
“	6-1	AC		C	
LBNDJ0015FCZZ	3-25	AA		C	
LBNDJ2003SCZZ	1-28	AA		C	
LBRC-6666RCZZ	5-2		N	C	
LBRC-6671RCSC	4-16	AN		C	
LFRM-2366BHZZ	2-5	BC		D	
LHLDZ2389BHZZ	3-21	AG		C	
LHLDZ2390BHZZ	3-22	AG		C	
LHLDZ6836BHZZ	2-4	AE		C	
LHLDZ6837BHZZ	2-3	AE		C	
LKGiM7110BHZZ	3-12	AE		B	
LKGiM7111BHZZ	3-12	AE		B	
LKGiM7331RCZZ	3-11	AK		B	
“	4-24	AK		B	
“	5-21	AK	N	B	
LKGiW0001BHZA	2-13	AS		B	
LKGiW7330RCZZ	4-29	AM		B	
“	5-20	AM	N	B	
LPiN-6643BHZZ	4-20	AG		C	
LPiN-6647BHZA	4-36	AG		C	
LPiN-6650BHZZ	5-10	AA		C	

PARTS CODE	NO.	PRICE RANK	NEW MARK	PART RANK	
LPLTM2368BHZZ	2-9	AY		C	
LPLTM2402RCZZ	5-36		N	D	
LPLTM6688RCZZ	4-11	AS		C	
LX-BZ2189BHZZ	6-2	AA		C	
LX-BZ6775BHZZ	4-3	AA		C	
“	5-29	AA		C	
LX-BZ6778BHZZ	4-10	AA		C	
“	5-33	AA		C	
LX-BZ6786BHZZ	1-50	AB		C	
LX-BZ6788BHZZ	1-4	AD		C	
【M】					
MCAMM6633BHZA	5-18	AE		C	
MCAMM6633RCZA	4-28	AE		C	
MLEVF6695RCZZ	5-5		N	C	
MLEVF6707RCZZ	4-18	AF		C	
MLEVP2346RCZZ	1-59	AE		C	
MSPRB6751BHZZ	5-38	AF		C	
MSPRC6712BHZZ	5-31	AF		C	
MSPRC6739BHZZ	4-7	AE		C	
MSPRD2410RCZZ	1-61	AB		C	
MSPRD6741BHZZ	1-44	AF		C	
MSPRK6718BHZZ	4-30	AF		C	
“	5-19	AF		C	
MSPRT6713BHZZ	5-30	AD		C	
MSPRT6714BHZZ	5-4	AE		C	
MSPRT6731BHZZ	4-17	AD		C	
MSPRT6732BHZZ	4-5	AC		C	
【N】					
NGERH2004RCZZ	3-3	AG		C	
NGERH2005BHZZ	1-45	AG		C	
NGERH2006RCZZ	1-40	AC		C	
NGERH6643RCZZ	1-43	AC		C	
NGERH6644RCZZ	1-42	AC		C	
NROLP6650BHZZ	4-13	AL		C	
“	4-35	AL		C	
“	5-13	AL		C	
“	5-39	AL		C	
NROLP6656RCZZ	1-35	AC		C	
【P】					
PCUT-2326RCZA	1-3	AC		C	
PFI LW2012BHZZ	1-9	AN		D	
PFI LW6961RCSG	1-8	AH		D	
PGiDH2394RCZZ	3-14	AG		C	
PGiDH2399RCSA	1-2	AC		C	
PGUMM2447BHZZ	2-7	BA		C	
PGUMM2512RCZZ	5-48		N	C	
PGUMM6695BHZZ	5-32	AE		C	
PGUMM6696RCZZ	4-37	AE		C	
“	4-8	AE		C	
“	5-34	AE		D	
PRDAF2374BHZA	6-3	AM		C	
PRDAF2374BHZZ	6-4	AM		C	
PRNGT6637BHZZ	4-31	AA		C	
“	5-22	AA		C	
PSHEP3243RCZZ	3-31			D	
PSHEP3244RCZZ	3-29			D	
PSHEP3245RCZZ	3-30			D	
PSHEP3256RCZZ	5-49		N	C	
PSHEP6681RCZZ	3-4	AC		C	
PSKR-6628BHZZ	5-8	AG		C	
【Q】					
QACCD1001RCPA	1-24	AH	N	B	
QCNCM3020RCZZ	6-5	AD		C	
QCNCM3021RCZZ	6-6			C	
QCNCM3022RCZZ	6-7			C	
QCNCM3023RCZZ	6-8	AC		C	
QCNCM7057BHZZ	6-9	AB		C	
QCNCM7136BHZZ	2-14	AB		C	
QCNCW2909BHZZ	7-1	AK		C	
QCNCW2910BHZZ	7-2	AK		C	
QCNCW3016RCZZ	6-10	AE		C	
“	7-3	AE		C	
QCNCW3017RCZZ	7-4	AD		C	
QCNCW3018RCZZ	6-201	AF	N	C	
QCNCW7202BH1E	8-1	AK		C	
QCNCW-3042BHZZ	1-17	AQ		C	
QCNCW-3156BHZA	6-11	AP		C	
QCNCW-3156BHZZ	6-12	AN		C	
QCNCW-3186BHZZ	1-16	AL		C	
QCNCW-3268RCZZ	7-5	AE		C	
QCNCW-3294RCZZ	1-55	AE		C	

PARTS CODE	NO.	PRICE RANK	NEW MARK	PART RANK	
QCNW-3295RCZZ	1- 46	AD		C	
QCNW-3296RCZZ	1- 47	AD		C	
QCNW-7768BHZZ	1- 51	AE		C	
QCNW-7813BHZZ	6- 13	AF		C	
QCNWG3190BHZZ	3- 18	AW		C	
QFS-B0322QCZZ	6- 14	AC		A	
QFSDH2109AFZZ	6- 15	AC		C	
QFS-K2007BHZZ	6- 16	AF		A	
QFS-K2315BHZZ	6- 17	AF		A	
QPIN-0003GCZZ	6- 18	AC		C	
QSOCN2328BHZZ	6- 19	AH		C	
QTANZ2002BHZZ	1- 32	AG		C	
QTANZ2346BHZA	1- 31	AF		C	
QTANZ2347BHZA	1- 34	AF		C	
QTANZ6657BHZA	1- 33	AD		C	
【R】					
RALMB5006SCZZ	6- 20	AD		B	
RCiLC2422RCZZ	6- 21			C	
RCiLC2427RCZZ	6- 22			C	
RCiLC2428RCZZ	6- 23			C	
RC-KZ1054CCN2	6- 24	AB		C	
“	7- 6	AB		C	
RCORF2361RCZZ	3- 19			C	
RCORF2362RCZZ	1- 27			C	
RCORF7002BHZZ	6- 25	AE		C	
RCRSP6676RCZZ	6- 26	AG		B	
RCRSZ2400RCZZ	6- 27	AH		B	
RMOTM2321BHZZ	1- 41	AS		B	
RPLUR2320BH01	5- 26	AY		B	
RTRNP2430BHZZ	1- 29	BE		B	
【S】					
SPAKA3181RCZL	3- 2			D	
SPAKA3181RCZR	3- 5	AR		D	
SPAKA3187RCAL	3- 2	AS		D	
SPAKA3187RCAR	3- 5	AS		D	
SPAKA3187RCBL	3- 2			D	
SPAKA3187RCBR	3- 5			D	
SPAKA8255BHZZ	5- 41	AC		D	
SPAKC3179RCSD	3- 1	BU	N	D	
SPAKC3179RCSE	3- 1		N	D	
SPAKC3317RCZZ	3- 26		N	D	
SSAKH3012CCZZ	3- 10	AA		D	
SSAKH3015CCZZ	3- 7	AA		D	
SSAKH4231CCZZ	3- 6	AA		D	
【T】					
TCADH2412BHZZ	3- 20	AD		D	
TCADH2445RCZZ	3- 16	AE	N	D	
TCADH2446RCZZ	3- 16	AE	N	D	
TCADH2453RCZZ	3- 17		N	D	
TCAUZ6681BHZZ	3- 9	AD		D	
TiNSK2501RCZZ	3- 8		N	D	
TiNSZ2500RCZZ	3- 8	AV	N	D	
TLABZ2640RCSA	3- 23		N	D	
TLABZ2640RCZZ	3- 23	AP	N	D	
TLABZ2662RCZZ	3- 27		N	D	
TPAPR2377RC05	9- 1	AY		S	
【U】					
UDSKA1013RCZZ	3- 24	BC	N	D	
UKOG-2365BHZZ	10- 2			S	
UKOG-6705RCZZ	10- 1	BC		S	
【V】					
VCCCTV1HH101J	6- 28	AA		C	
VCCCTV1HH180J	6- 29	AA		C	
VCCCTV1HH270J	6- 30	AA		C	
VCCCTV1HH300J	6- 31	AA		C	
VCCCTV1HH331J	6- 32	AA		C	
VCEAGA1CW337M	6- 34	AB		C	
VCEAGA1HW227M	6- 36	AC		C	
VCEAGA1HW475M	6- 37	AA		C	
VCEAGD1CW108M	6- 39	AE		C	
VCEAGD1CW478M	6- 40	AP		C	
VCEAGU1CW106M	6- 33	AA		C	
VCEAGU1CW107M	7- 7	AB		C	
VCEAGU1HW106M	6- 35	AB		C	
VCEAGU1HW476M	6- 38	AB		C	
VCEAZU1HW338M	6- 41			C	
VCEAZU1VW108M	6- 42	AE		C	
VCKYPU1HB101K	6- 43	AA		C	
“	7- 8	AA		C	
VCKYPU1HB102K	6- 44	AA		C	
VCKYPU1HB151K	6- 45	AA		C	

PARTS CODE	NO.	PRICE RANK	NEW MARK	PART RANK	
VCKYTV1HB222K	6- 46	AA		C	
VCKYTV1HF104Z	6- 47	AA		C	
VCQYKU1HM223K	6- 48	AB		C	
VCQYNA1HM333K	6- 49	AA		C	
VCQYNU1HM104K	6- 50	AB		C	
VHD1N4002//-1	6- 51			B	
VHDCP301///-1	6- 52	AL		B	
VHDDSS133///-1	6- 53	AA		B	
“	7- 9	AA		B	
VHDFMB-G24H/1	6- 54	AH		B	
VHDBR060L///-1	6- 55	AK		B	
VHDBR721Q///-1	6- 56	AE		B	
VHEMTZJ5R1B-1	6- 57	AB		B	
VHEPTZ6.2A/-1	6- 58	AH		B	
VHEPTZ9.1B+-1	6- 59	AG		B	
VHEUDZ4.3B/-1	6- 60	AE		B	
VH12574NADJ-1	6- 61	AW		B	
VH130624FGA03	6- 62		N	B	
VH1621024M7-1	6- 63	AZ		B	
VH180928CNM-1	6- 64			B	
VH1BA10393F-1	6- 65	AC		B	
VH1HIN211CA-1	6- 66	AN		B	
VH1KID65083AP	7- 10	AM		B	
VH1LB1838M+-1	6- 67	AT		B	
VH1PQ1CG2032F	6- 68	AL		B	
VH1SN74HC138N	6- 69	AL		B	
VH1SN74HC374D	6- 70	AL		B	
VHPLA56S1S20C	8- 3	AN		B	
VHPLA56S2S20C	7-101	AQ		B	
“	8- 2	AQ		B	
VRD-HT2EY101J	6- 71	AA		C	
VRD-HT2EY103J	6- 72	AA		C	
VRD-HT2EY121J	7- 11	AA		C	
VRD-HT2EY202J	6- 73	AA		C	
VRD-HT2EY221J	6- 74	AA		C	
VRD-HT2EY223J	6- 75	AA		C	
VRD-HT2EY270J	8- 4	AA		C	
VRD-HT2EY272J	6- 76	AA		C	
VRD-HT2EY300J	7-102	AA		C	
VRD-HT2EY330J	6- 77	AA		C	
VRD-HT2EY332J	6- 78	AA		C	
VRD-HT2EY335J	6- 79	AA		C	
VRD-HT2EY472J	6- 80	AA		C	
VRD-HT2EY473J	6- 81	AA		C	
“	7- 12	AA		C	
VRD-HT2EY912G	6- 82	AA		C	
VRG-ST2EJ100J	6- 83	AC		B	
VRS-CY1JD000J	6- 84	AA		C	
VRS-CY1JD102J	6- 85	AA		C	
VRS-CY1JD103F	6- 86	AB		C	
VRS-CY1JD103J	6- 87	AA		C	
VRS-CY1JD104J	6- 88	AA		C	
VRS-CY1JD123J	7- 13	AA		C	
VRS-CY1JD183J	6- 89	AA		C	
VRS-CY1JD222J	6- 90	AA		C	
VRS-CY1JD223J	6- 91	AA		C	
VRS-CY1JD272J	6- 92	AA		C	
VRS-CY1JD331J	6- 94	AA		C	
VRS-CY1JD332F	6- 93	AA		C	
VRS-CY1JD471J	6- 95	AA		C	
VRS-CY1JD473J	6- 96	AA		C	
VRS-CY1JD563J	6- 97	AA		C	
VRS-CY1JD821J	6- 98	AA		C	
VRSCY1JR1782F	6- 99			C	
VRS-CY2AY243F	6-100	AA		C	
VRS-CY2AY272F	6-101	AA		C	
VRS-CY2AY303F	6-102	AA		C	
VRS-CY2AY392J	6-103	AA		C	
VRS-CY2AY473F	6-104	AA		C	
VRS-CY2AY510J	6-105	AA		C	
VRS-CY2AY561J	6-106	AA		C	
VRS-CY2AY911F	6-107	AA		C	
VRS-TQ2BJ000J	6-108			C	
VS2SD2212++-1	6-109	AG		B	
VS2SK2731///-1	6-110	AD		B	
VSKRA101M///-1	7- 14	AD		B	
VSKRA106S///-1	6-111	AF		B	
VSKRC106S///-1	6-112	AD		B	
VSKRC111S///-1	6-113	AD		B	
VSKTA1663///-1	7- 15	AE		B	
VSKTA1664///-1	7- 16	AD		B	

SHARP

COPYRIGHT © 2003 BY SHARP CORPORATION

All rights reserved.

Printed in Japan.

No part of this publication may be reproduced,
stored in a retrieval system, or transmitted.

In any form or by any means,
electronic, mechanical, photocopying, recording, or otherwise,
without prior written permission of the publisher.

SHARP CORPORATION
Digital Document Systems Group
Products Quality Assurance Department
Yamatokoriyama, Nara 639-1186, Japan
2003 October Printed in Japan ⓘ